

FISHING OPERATIONS

1. An emergency disconnect, due to a broken anchor chain from heavy weather, forced a fishing operation for the sheared drillpipe which was hung off on the pipe rams. A total of 88-1/2 hours were lost from a combination of WOW, re-running the No. 7 anchor, and milling over and retrieving the fish in the BOP. (See attachment No 2)
2. While running the DST No. 1 test string, the fluted hanger 4-1/2" LTC threaded crossover stripped out of the subsea tree lower body and landed in the wellhead. The subsequent fishing operation required 105-1/2 hours to retrieve and test the string, scrape casing, and re-run the test string.

Probable cause of failure is due to improper subsea tree inspection.