

<u>DAY</u>	<u>JULY</u>	<u>DESCRIPTION</u>
40	18	WOW.
41	19	Run # 3 anchor. Re-latch LMRP. Recover drill pipe RIH to bottom 85' fill. Circulate bottoms up thru choke. 4-1/2% max gas. Run Intermediate logs. Run Schlumberger ISF-BHC-GR-SP-MSFL-CAL.
42	20	Run LDT-CNL-GR log. Test stack. RIH and drill 12-1/4" hole from 6509' - 6760' and circulate samples.
43	21	Drill 12-1/4" hole from 6760' - 7142'. Drop survey. Circulate bottoms up and POOH to shoe for weather. Hole tight from 6610' - 6579'. 60k max overpull. WOW.
44	22	WOW.
45	23	WOW
46	24	WOW. Relatch LMRP. Recover drill string, RIH to 7131', 11' of fill. Wash to 7142', circulate bottoms up. Max gas 15%. Drill 12-1/4" hole from 7142' - 7277'.
47	25	Drill and survey 12-1/4" hole from 7277' - 7726'. Circulate bottoms up and POOH to shoe for weather. WOW.
48	26	WOW.
49	27	WOW. Relatch LMRP, retrieve drill string. RIH to 7718', 8' fill. Circulate bottoms up, max gas 21.5%. Drill 12-1/4" hole from 7726' - 7752'.
50	28	Drill 12-1/4" hole from 7752' - 8003'. Circulate bottoms up and POOH to shoe for weather. Hang off. Release LMRP WOW.
51	29	WOW.
52	30	WOW.
53	31	WOW.