

<u>DAY</u>	<u>AUGUST</u>	<u>DESCRIPTION</u>
66	13	Drlg 10,271' - 10,412'. Work junk-sub survey. POH. Tight spot at 8630' - 8640', 60k overpull. RIH. Wash and ream 10,362' - 10,412'. Drlg 10,412' - 10,422'.
67	14	Drlg. 10,422' - 10,643'.
68	15	Drill 12-1/4" hole from 10,643'-10,879'. Circulate bottoms up, drop survey, POOH for new bit.
69	16	Continue POOH, test BOP, RIH. Drill 12-1/4" hole from 10,879'-10,960'.
70	17	Drill 12-1/4" hole from 10,960'-10,972'. POOH to casing shoe to WOW. RIH to 9137'. POOH to 8973' due to weather. Anchor No. 7 broke in the master link, activate emergency shear/disconnect, WOW.
71	18	WOW. Retrieve anchor No. 7 and chain, WOW.
72	19	WOW.
73	20	WOW. Re-run anchor No. 7, pre-tension anchor slipping. Re-run anchor No. 7 with piggy-back. Pre-tension to 310 kips. Re-latch LMRP, RIH to fish for sheared drillpipe in BOP.
74	21	RIH, mill fish, engage and pull 110,000 lbs overpull. Fishing string parted @ overshot. RIH with overshot, engage fish, POOH with 130,000 lbs overpull. Lay out fishing string, circulate bottoms up @ 8690'. RIH, wash and ream from 8720' - 9262'. Circulate bottoms up @ 9846'. RIH to 10,972', circulate bottoms up, 2.5% Max gas. Drill from 10,972' - 10,974'. Circulate sample and condition mud.