

<u>DAY</u>	<u>SEPTEMBER</u>	<u>DESCRIPTION</u>
85	1	POOH with R.F.T. #5. RIH with C.S.T. Sidewall core guns. Shoot 49 out of 57 cores. RIH for cleanout trip. Wash and ream from 10,200' - 10,981'. Circulate and condition mud.
86	2	Short trip 10 stands, POOH. Rig up and run 216 jnts, N-80, 47 ppf 9-5/8" casing. Hang off casing in wellhead, circulate hole, W.O.W.
87	3	Retrieve hungoff casing. Run 56 jnts, N-80, 47 ppf 9-5/8" casing. Run 9-5/8" casing landing string. Land casing in wellhead. Shoe @ 10,957'. Top of shut off baffle @ 10,837', top of D.V. collar @ 6477'. Mix and pump 1975 sxs of Class G cement with 0.5% BWOC Halad - 22A, 9.6 gal /10 bbl CFR-2L, 6.9 gal/10 bbl. HR-13L @ 15.8 ppg with a yield of 1.15 cuft/sx with 5 gal/sx drill water. Drop D.V. bomb, open D.V. collar with 1300 psi. Circ x W.O.C.
88	4	Mix and pump 2nd stage slurry of 435 sxs Class G cement with 0.5% BWOC Halad - 22A, 9.6 gal/10 bbl CFR-2L, 6.9 gal/10 bbl HR-13L @ 15.8 ppg with a yield of 1.15 cuft/sx with 5 gal/sx drill water. Drop D.V. close plug, close D.V. collar, bump plug with 3000 psi. Release from casing hanger, RIH and wash wellhead, no go past BOP. POOH, install wash tool centralizer. RIH and wash wellhead. POOH. RIH with seal assembly, no test, POOH. RIH and wash wellhead, RIH with seal assembly, test against RTTS, no test. POOH with seal assembly.