

## SEQUENCE OF OPERATIONS

OEC-872-1-B-SIN

TEST NUMBER

RIG NAME

PAGE OF

DST#1-6

DIAMOND M. EPOCH

2 14

CUSTOMER

WELL NAME OR NUMBER

FIELD

AREA

AMOCO AUSTRALIA PETROLEUM CO.

PELICAN #5

PELICAN

BASS STRAIT

CUSTOMER REPRESENTED BY

OTIS TEST SUPERVISOR

Mr. J Guillery/E Bowden/J Harkin/T Mosness

TONY WOOLHAM / GRAHAM MCKAY

DATE

TIME

OPERATIONS

DATE	TIME	OPERATIONS	
1			1
12MAR86	1400	UNABLE TO PRESSURE TEST SUBSEA TEST TREE BALLS FROM BELOW - INDICATION OF	2
		BALLS NOT CLOSING	3
	1415	STARTED PULLING LANDING STRING OUT OF HOLE	4
	1425	LAI D DOWN SURFACE TEST TREE	5
	1435	LAI D BACK SUBSEA LUBRICATOR VALVE IN DERRICK	6
	1440	SUBSEA TEST TREE AT SURFACE. CONTROL LINE PORTS FLUSHED THROUGH	7
		BALLS FUNCTIONED SEVERAL TIMES AND APPEARED TO BE OPERATING CORRECTLY	8
	1725	SUBSEA TEST TREE RAN IN HOLE	9
	1745	SUBSEA LUBRICATOR VALVE RAN IN HOLE	10
	1800	SUBSEA TEST TREE LANDED OUT IN WELLHEAD. RAMS CLOSED	11
		UNABLE TO PRESSURE TEST BALLS - INDICATION OF BALLS NOT CLOSING	12
	1810	LANDING STRING PULLED OUT OF HOLE	13
		SUBSEA TEST TREE SERVICE BROKE AND LAI D DOWN FOR INSPECTION	14
		SUBSEA TEST TREE FUNCTIONED ON DECK WITH NO OBVIOUS SIGN OF PROBLEM ALTHOUGH	15
		CLOSING TIME OF BALL WAS LOWER WHEN BLE D BACK THROUGH REEL PACK	16
13MAR86	0015	SUBSEA TEST TREE PICKED UP AND RAN IN HOLE	17
	0040	SUBSEA LUBRICATOR VALVE PICKED UP AND RAN IN HOLE	18
	0100	SUBSEA TEST TREE BALLS PRESSURE TESTED TO 3000 PSI - OKAY	19
	0115	LAI D BACK SUBSEA TEST TREE IN DERRICK	