

Drilling Day # 41 (14.8.82) cont.

POOH, run Schlumberger, (Cement Bond Log).
Rig down Schlumberger and RIH to 9030ft.
Circulate and squeeze cement.

Drilling Day # 42 (15.8.82)

POOH and RIH with Bit # 22, run sequence # 24.
Circulate, test casing, tag bottom and drill 5ft of formation to
9045ft LOT, formation broke at 10.1 ppg.
Drill ahead to 9288ft.

Drilling Day # 43 (16.8.82)

Drill ahead to 9501ft circulate and POOH.
RIH with Bit # 23, run sequence # 25.
Ream down from 9037ft.

Drilling Day # 44 (17.8.82)

Reaming, drill ahead. Block off one jet increasing SPP.
Drill ahead to 9887ft.
Circulate and POOH.

Drilling Day # 45 (18.8.82)

RIH with Bit # 24, run sequence # 26.
Ream down last 5 joints, block off one jet increasing SPP.
Drill ahead.
Pull off bottom to repair kelly bushings.
Drill ahead.
Hole caving in, pump pill to displace cavings.

Drilling Day # 46 (19.8.82)

Drill ahead, pump pill to displace cavings.
Circulate and POOH.
RIH with Bit # 25, run sequence # 27.
Cut and slip dead line.
Ream Down from 9940ft, block off one jet.
Drill ahead to 10099ft.