

South Mackintosh

The south Charter track currently extends to 1650N/5050E, however for some time vehicular access has virtually been impossible past 2300N/4680E. It is suggested that this section of track should be rehabilitated.

Mount Charter

The main access track to Mount Charter area has two major problem areas, crossing the dolerite.

A steep section east of the MC-8 site. If further work is planned in this area serious consideration should be given to re-routing this track. Two major E-W costeans on 4500N and 4550N are steep and show some regrowth but are mildly eroded. Advice should be sought on the best method of rehabilitation as these costeans are no longer required. The junction of the 4500N costean and the MC-6 access track should be re-contoured and fertilised while the MC-6 access track itself appears to have no major drainage problems but regrowth is only marginal. Advice on rehabilitation of this section of track and the drill site itself should be sought. The system of tracks north of MC-3 and leading east to the MAC-25 site are generally revegetating satisfactorily, however in some steep areas, particularly the track just north of 4800N, erosion is occurring. Hand dug drainage channels may rectify this problem.

A. McNeill.