


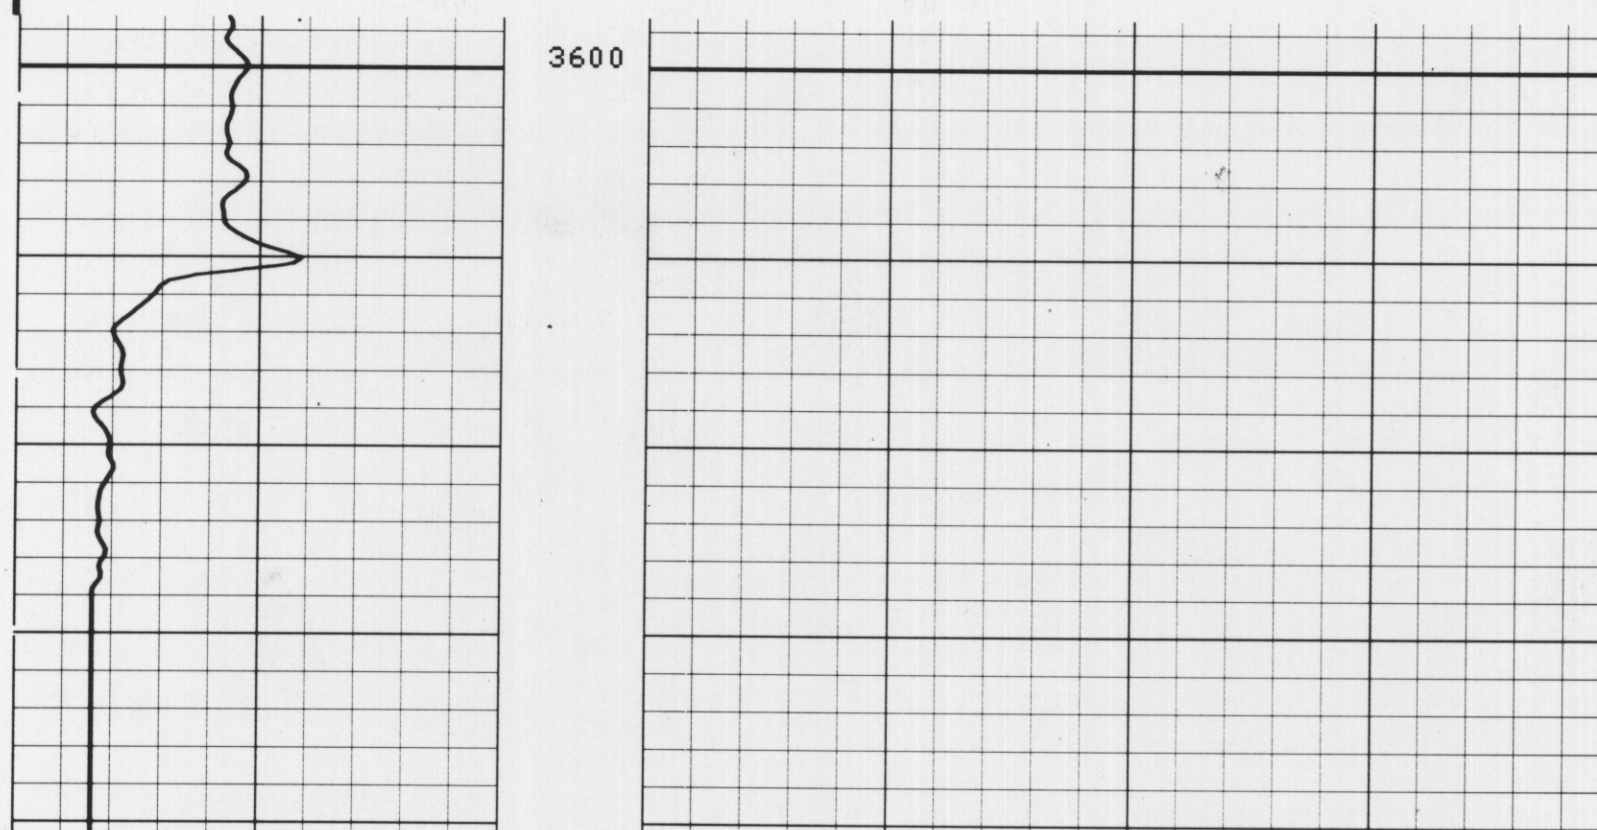

CP 28.2 FILE 1 11-FEB-86 14:59

GR (GAPI)
0.0 150.00

SENSOR MEASURE POINT TO TOOL ZERO

TENS 0.0 METER

GR 6.38 METER

PARAMETERS

NAME	VALUE	UNIT	NAME	VALUE	UNIT
SGSN	77398		CDAT	20 12 85	
RFTT	245.500	DEGF	FDEP	3021.48	M
HPSN	974		RPU	PSIG	
TZRV	453.000	OHMS	TCRV	761.450	OHMS
FLD	1.00000	G/C3	HPT	223.253	DEGF
BS	8.50000	IN	BHS	OPEN	

5 cm

CP 28.2 FILE 0 11-FEB-86 12:50

PRESSURE UNITS: PSIG
TEMPERATURE UNITS: DEGFSTRAIN GAUGE SERIAL NUMBER: 77398
ATMOSPHERIC PRESSURE: 14.7 PSIA
AMBIENT TEMPERATURE: 70.00 DEGF
CALIBRATION DATE: 20 12 85PRESS TABLE #: 1
PRESSURES: 0.0 1000.0

TMP/CORR #	TEMP	CORR	TEMP	CORR
1 :	300.000	8.000	300.000	2.300
2 :	252.000	10.000	252.000	4.300
3 :	210.000	9.000	210.000	2.300
4 :	157.000	13.000	157.000	8.300
5 :	62.000	21.000	62.000	15.300

PRESS TABLE #: 3
PRESSURES: 2000.0 3000.0

TMP/CORR #	TEMP	CORR	TEMP	CORR
1 :	300.000	-1.300	300.000	-1.000
2 :	252.000	-2.300	252.000	-4.000
3 :	210.000	-2.300	210.000	-2.000
4 :	157.000	2.700	157.000	2.000
5 :	62.000	8.700	62.000	7.000

PRESS TABLE #: 5
PRESSURES: 4000.0 5000.0

TMP/CORR #	TEMP	CORR	TEMP	CORR
1 :	300.000	.500	300.000	2.900
2 :	252.000	-2.500	252.000	-3.100
3 :	210.000	-1.500	210.000	-1.100
4 :	157.000	1.500	157.000	2.900
5 :	62.000	6.500	62.000	5.900

PRESS TABLE #: 7
PRESSURES: 6000.0 7000.0

TMP/CORR #	TEMP	CORR	TEMP	CORR
1 :	300.000	3.300	300.000	3.700
2 :	252.000	-3.700	252.000	-5.300
3 :	210.000	-1.700	210.000	-3.300
4 :	157.000	2.300	157.000	.700
5 :	62.000	4.300	62.000	1.700

PRESS TABLE #: 9
PRESSURES: 8000.0 8500.0

TMP/CORR #	TEMP	CORR	TEMP	CORR
1 :	300.000	3.000	300.000	2.800
2 :	252.000	-8.000	252.000	-10.200
3 :	210.000	-7.000	210.000	-9.200
4 :	157.000	-3.000	157.000	-5.200
5 :	62.000	-2.000	62.000	-4.200

